

Autonics

SCALING METER M4NS/M4YS SERIES

M A N U A L



Thank you very much for selecting Autonics products.
For your safety, please read the following before using.

Caution for your safety

- *Please keep these instructions and review them before using this unit.
- *Please observe the cautions that follow:
- Warning** Serious injury may result if instructions are not followed.
- Caution** Product may be damaged, or injury may result if instructions are not followed.
- *The following is an explanation of the symbols used in the operation manual.
- caution:**Injury or danger may occur under special conditions.

Warning

1. In case of using this unit with machineries(Nuclear power control, medical equipment, vehicle, train, airplane, combustion apparatus, entertainment or safety device etc), it requires installing fail-safe device, or contact us for information on type required.
- It may result in serious damage, fire or human injury.


Caution

1. It must be mounted on panel.
It may give an electric shock.
2. Do not repair, check up or connect when power on and measuring input applied.
It may give an electric shock.
3. Do not disassemble and modify this unit, when it requires. If needs, please contact us.
It may give an electric shock and cause a fire.
4. This unit shall not be used outdoors.
It might shorten the life cycle of the product or give an electric shock.
5. Please observe specification rating.
It might shorten the life cycle of the product and cause a fire.
6. Be sure that there is not insulated between measuring input terminal and power terminal.
It may cause mechanical trouble of measuring target or result in product damage.
7. Please wire properly after check polarity of power.
It may cause a fire or explosion and result in product damage.
8. In cleaning the unit, do not use water or an oil-based detergent.
It might cause an electric shock or fire that will result in damage to this product.
9. Do not use this unit at place where there are flammable or explosive gas, humidity, direct ray the sun, radiant heat, vibration, impact etc.
It may cause explosion.
10. Do not inflow dust or wire dregs into inside of this unit.
It may cause a fire or mechanical trouble.
11. Please connect properly after checking the polarity of measuring terminals.
It may cause a fire or explosion.

Ordering information

M	4	N	S	-	N	A
Measuring input range						
A	DC4~20mA					
Power supply		N	Loop powered type			
Measurement range		S	Scaling			
Size		N	DIN W48 × H24mm			
		Y	DIN W72 × H36mm			
Digit	4	9999(4Digit)				
Item	M	Meter				

Front panel identification

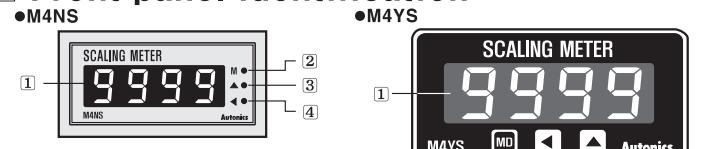

① Display value, Parameter, Error display

② M, MD Key: When enter into Parameter group, return to RUN mode,
After completing Parameter setting

③ ▲, ▼ (Up) key: When enter into the status of Parameter setting

④ ▶, ▶ (Shift) key: When enter into the status of Parameter setting and move Digit


*The above specifications are subject to change and some models
may be discontinued without notice.

Specifications


Model	M4NS-NA	M4YS-NA
Power supply	Loop powered type	—
Power consumption	—	—
Display method	7 Segment LED Display	—
Character height	10mm	14mm
Display accuracy *1	F.S. 0.3% rdg ±1Digit	—
Display cycle	Selectable 0.5sec/1sec/2sec/3sec/4sec/5sec	—
Resolution	12,000 resolution	—
Max. display	—1999 to 9999	—
Setting type	Setting type with the front keys	—
Measuring input range *2	DC4~20mA	—
Self-diagnosis function	Error display function	—
Insulation resistance	Min. 100MΩ (at 500VDC megger)	—
Dielectric strength	2000VAC 50/60Hz for 1 min.	—
Vibration	Mechanical 0.75mm amplitude at frequency of 10 ~ 55Hz(for 1 min.) in each X, Y, Z direction for 1 hour Malfunction 0.5mm amplitude at frequency of 10 to 55Hz in each X, Y, Z direction for 10 minutes	—
Shock	Mechanical 300m/s ² (30G) in X, Y, Z directions for 3 times Malfunction 100m/s ² (10G) in X, Y, Z directions for 3 times	—
Environ-ment	Ambient temperature -10 ~ 50°C, Storage temperature: -25 ~ 60°C Ambient humidity 35 ~ 85%RH, Storage humidity: 35 ~ 85%RH	—
Weight	Approx. 44g	Approx. 110g

- *1: Ambient temperature(25°C ±5°C): F.S. 0.3% rdg of ±1Digit(-10 ~ 50°C: F.S. 0.4% rdg ±1Digit)
- *2: Impedance between input lines: Max. 600Ω (based on 24VDC)
Please be aware that activating input power is based on 24VDC, and the recommended impedance also will be lowered if the activating power is lower.
- *Environment resistance is rated at no freezing or condensation.

Dimensions

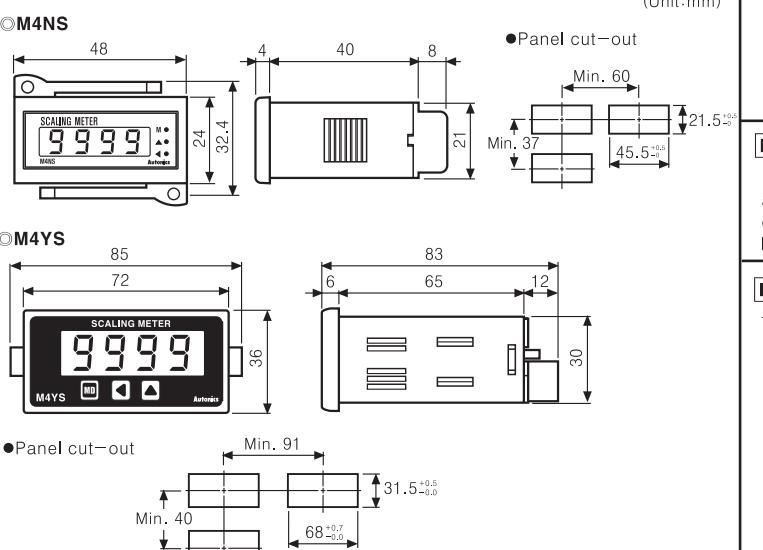


Connections

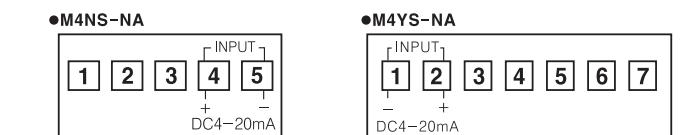


Prescale function

This function is to display the value with setting certain Hi/Low limit value against 4~20mADC input. For example If set a=4mADC, b=20mADC and A,B as display value, it will be displayed a=A, b=B.

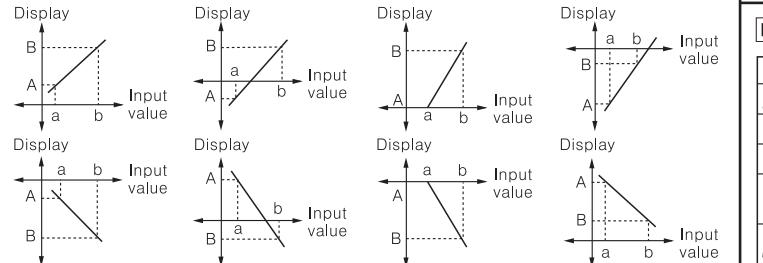

Decimal point setting function [dot]


This function is to set the decimal point position of display value (Set in Parameter setting group).

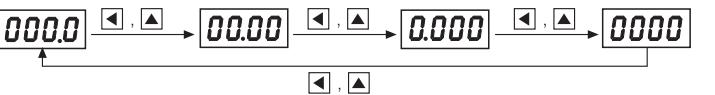

Correction function(Parameter group: [*I nbH*], [*I nbL*])

This function is to adjust the error of display value after calculating scale value for measuring input and also correct the input error of sensor etc.
[*I nbL*]: -100 ~ 100 [Adjust deviation of Low value].
[*I nbH*]: 0.900 ~ 1.100 [Adjust deviation gradient of high value(%)].
Ex) When display value is 0.0 to 500.0 against 4~20mA input, if the display value is "1.2" for 4mA input, set -12(Ignore the decimal point) as [*I nbL*] value to display "0.0". It is enable to remove offset of Low display value.
*When completed above Low value setting then apply 20mA, if the display value is "500.5, the correction value will be 5005/5000=0.999, set 0.999 as [*I nbH*] value then enable to correct High value is 5005×0.999 = 5000). It is also ignore the decimal point.

Parameter setting

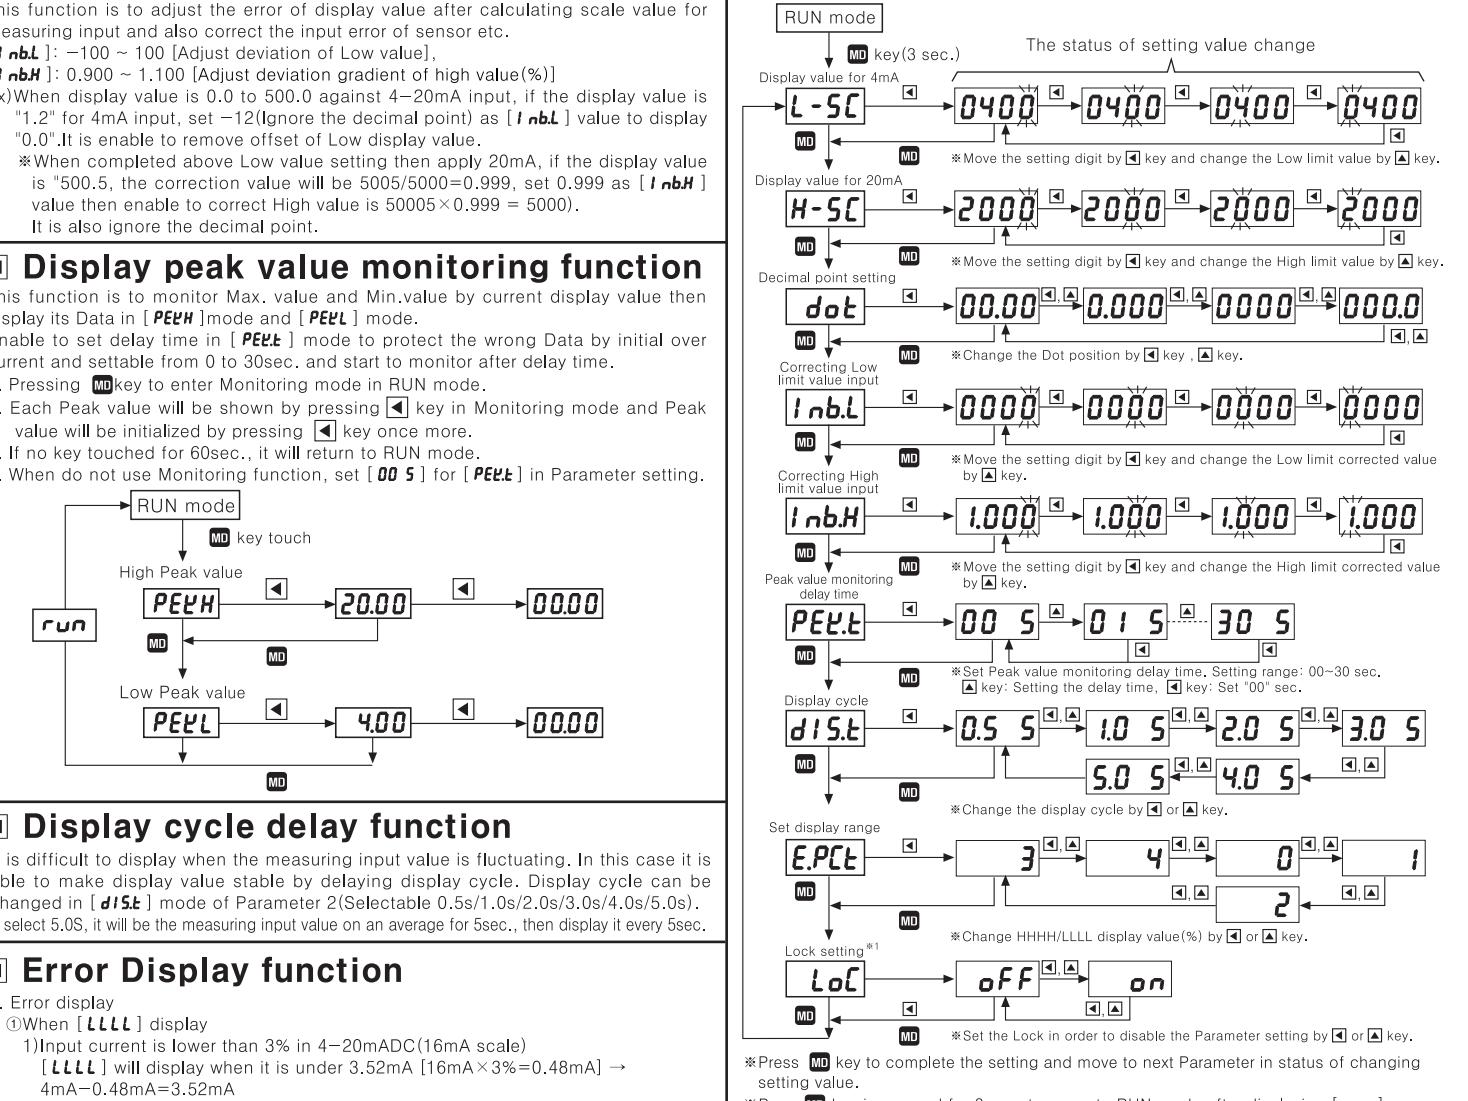

Display cycle delay function

It is difficult to display when the measuring input value is fluctuating. In this case it is able to make display value stable by delaying display cycle. Display cycle can be changed in [*d15t*] mode of Parameter 2(Selectable 0.5s/1.0s/2.0s/3.0s/4.0s/5.0s). If select 5.0s, it will be the measuring input value on an average for 5sec., then display it every 5sec.

Error Display function

1. Error display
 - ① When [*LLLL*] display
 - 1) Input current is lower than 3% in 4~20mADC(16mA scale)
[*LLLL*] will display when it is under 3.52mA [16mA×3% = 0.48mA] → 4mA - 0.48mA = 3.52mA
 - 2) When it is beyond Min. display value(-1999) [by display value]
 - ② When [*HHHH*] display
 - 1) Input current is higher than 3% in 4~20mADC(16mA scale)
[*HHHH*] display [16mA×3% = 0.48mA] → 20mA + 0.48mA = 20.48mA. When it is higher than 20.48mA.
 - 2) When it is beyond Max. display value(9999) [by display value]
 2. Turn Error display off
[*LLLL*] and [*HHHH*] are displayed when input is out of measuring range, therefore it will be disappeared automatically when input returns to measuring range.
 3. Error setting and sort
It will display the error message according to the setting value which set % value against analog input range and set it in [*E.PCt*] mode by [◀], [▶] key.

[<i>E.PCt</i>]Mode	Error description
0	[<i>LLLL</i>], [<i>HHHH</i>] are displayed when it is over 0% out DC4~20mA range
1	[<i>LLLL</i>], [<i>HHHH</i>] are displayed when it is over 1% out DC4~20mA range
2	[<i>LLLL</i>], [<i>HHHH</i>] are displayed when it is over 2% out DC4~20mA range
3	[<i>LLLL</i>], [<i>HHHH</i>] are displayed when it is over 3% out DC4~20mA range
4	[<i>L-SC</i>], [<i>H-SC</i>] are displayed always when it is out DC4~20mA range

Parameter

Parameter	Function	Setting range
<i>L-SC</i> (Low Scale)	Low limit display value for 4mA input	-1.999 ~ 9.999 -19.99 ~ 99.99
<i>H-SC</i> (High Scale)	High limit display value for 20mA input	-199.9 ~ 999.9
<i>dot</i> (Dot)	Set Decimal point position	-1999 ~ 9999
<i>I nbL</i> (Input bias low)	Input correction of low limit value(Digit)	-100 ~ 100
<i>I nbH</i> (Input bias high)	Input correction of high limit value(%)	0.900 ~ 1.100
<i>PEEL</i> (Peak Time)	See the peak value monitoring delay time	0 ~ 30sec
<i>d15t</i> (Display period)	Selectable sampling period(sec)	Selectable 0.5/1.0/2.0 /3.0/4.0/5.0
<i>E.PCt</i> (Error %)	Display the measurement input is out of input range	0, 1, 2, 3, 4
<i>LoC</i> (Lock)	Set lock function	Selectable ON, OFF

Caution for using

1. Please use separated line from high voltage line or power line in order to avoid inductive noise.
 2. Please use power switch or circuit breaker in order to turn OFF the power.
 3. The switch or circuit breaker should be installed near by users for safety.
 4. Be sure to avoid using this unit near by machinery makes strong high frequency noise. (Welding machine, high capacity SCR unit etc.)
 5. Input line : Shield wire must be used when the measuring input line is getting longer or there are lots of noises.
- *It may cause malfunction if above instructions are not followed.

Major products

Photoelectric sensors	Temperature controllers
Fiber optic sensors	Humidity transducers
Door sensors	SSR/Power controllers
Door side sensors	Counters
Area sensors	Timers
Proximity sensors	Panel meters
Pressure sensors	Tachometers/Pulse(Rate) meters
Rotary encoders	Display units
Connector/Sockets	Sensor controllers
Switching mode power supplies	Field network devices
Control switches/Lamps/Buzzers	Laser marking system(Fiber, CO ₂ , Nd-YAG)
I/O Terminal Blocks & Cables	Laser welding/soldering system
Stepper motors/drivers/motion controllers	
Graphical Logic panels	

Autonics Corporation
http://www.autonics.com
Satisfiable Partner For Factory Automation

HEAD QUARTERS:
18, Bansong-ro 513beon-gil, Haeundae-gu, Busan, Korea
OVERSEAS SALES:
#402-404, Bucheon Techno Park, 655, Pyeongchon-ro, Womji-gu, Bucheon, Gyeonggi-do, Korea
TEL: 82-32-610-2730 / FAX: 82-32-329-0728
E-mail: sales@autonics.com